



1 SCOPE

This document details the application of SOP 40 issued by the Electricity Association.

2 ISSUE RECORD

This is a controlled maintained document

All copies printed via the Intranet or photocopied will be deemed uncontrolled.

Issue Date	Issue No	Author	Amendment Details
October 2000	1	Esther Stewart	Initial Issue in New Format: 2 Page Document

3 ISSUE AUTHORITY

Author	Owner	Issue Authority
Esther Stewart	Roger Bracey	Roger Bracey Group Head, Standards



4 SOP DETAILS

TYPE: Reyrolle LMT 11 kV O.C.B.

ORIGINATING REC: Midlands Electricity Board

DATE: 16/6/86

NO. INSTALLED IN MANWEB: 33

NO. INSTALLED IN SCOTLAND:

STATUS: Restriction - If fitted with auto-reclose no local closing onto suspected faulty circuit until inspected as PSB 24.

REASON: An auto-reclose LMT o.c.b., which had operated to clear faults several times, ruptured. There was substantial erosion of the turbulator vent block.

UPDATE:

REMEDIAL ACTION: Inspect units with high rate of operation. Change eroded vent blocks. See P.S.B. No. 24.