



1 SCOPE

This document details the application of SOP 105 issued by the Electricity Association.

2 ISSUE RECORD

This is a controlled maintained document

All copies printed via the Intranet or photocopied will be deemed uncontrolled.

Issue Date	Issue No	Author	Amendment Details
October 2000	1	Esther Stewart	Initial Issue in New Format: 2 Page Document

3 ISSUE AUTHORITY

Author	Owner	Issue Authority
Esther Stewart	Roger Bracey	Roger Bracey Group Head, Standards



4 SOP DETAILS

TYPE: LONG AND CRAWFORD T4GF3 (11 kV and 6.6 kV) R.M.U. Manufactured in October/November 1990

ORIGINATING REC: NORWEB

DATE: 11/1/91

NO. INSTALLED IN MANWEB: 185

NO. INSTALLED IN SCOTLAND:

STATUS: Live Operation Banned. Access Restricted.

REASON: Possible hairline cracks in bushing from oil switch tank into cable box chamber (Manufactured Oct/Nov 1990).

UPDATE:

REMEDIAL ACTION: Pending Manufacture investigation. No live operation. No person in substation when switchgear being energised. Essential substation access only when switchgear energised. No re-energisation without inspection after switchgear has carried fault current.PSB 55.