



1 SCOPE

This document details the application of SOP 140 issued by the Electricity Association.

2 ISSUE RECORD

This is a controlled maintained document

All copies printed via the Intranet or photocopied will be deemed uncontrolled.

Issue Date	Issue No	Author	Amendment Details
October 2000	1	Esther Stewart	Initial Issue in New Format: 2 Page Document

3 ISSUE AUTHORITY

Author	Owner	Issue Authority
Esther Stewart	Roger Bracey	Roger Bracey Group Head, Standards



4 SOP DETAILS

TYPE: Lucy SCRMU (CB Type)

SCRMU units affected are: All with 6056 serial Nos. prefix 6075/1 to /17 inclusive
And 6075/19 to /24 inclusive, 6075/27, 6075/35. SCRMUE units affected are serial number
6110/4 only

ORIGINATING REC: London Electricity

DATE: 17/11/94

NO. INSTALLED IN MANWEB: 0
NO. INSTALLED IN SCOTLAND:

STATUS: Restriction (None in Manweb)

No live operations. Access restricted to short duration essential tasks.

NOTE There is no restriction on the operation of the tee-off selector or circuit breaker.

REASON:

London Electricity reported a defect on a Lucy SCRMU (CB Type) 11kV ring main unit. The defect related to a broken ring switch contact carrier moulding. The unit in question had failed its pre-delivery inspection. Lucy have informed that the design of the moulding was strengthened in March 1994, but all earlier units are suspect and the ring switches should not be operated until further notice.

UPDATE:

REMEDIAL ACTION: