

# SUSPENSION OF OPERATIONAL PRACTICE OPSAF-16-189 **SOP 189**

Issue No. 1 October 2000

#### **SCOPE** 1

This document details the application of SOP 189 issued by the Electricity Association.

### 2 **ISSUE RECORD**

This is a controlled maintained document

All copies printed via the Intranet or photocopied will be deemed uncontrolled.

<b>Issue Date</b>	Issue No	Author	<b>Amendment Details</b>
October 2000	1	Esther Stewart	Initial Issue in New Format: 2 Page Document

### 3 **ISSUE AUTHORITY**

Author	Owner	Issue Authority
Esther Stewart	Roger Bracey	Roger Bracey Group Head, Standards



## SUSPENSION OF OPERATIONAL PRACTICE OPSAF-16-189 **SOP 189**

Issue No. 1 October 2000

## **SOP DETAILS**

TYPE: ATL Type AMD Tap Changers

Tap changers with coarse/fine winding arrangements fitted with tie in resistors on 132kV transformers.

**ORIGINATING REC:** EAST MIDLANDS ELECTRIC

**DATE:** 25/07/97

NO. INSTALLED IN MANWEB: 0

NO. INSTALLED IN SCOTLAND:

STATUS: Ban:

Tap changer not to be operated through the changeover positions with the transformer live.

**REASON:** 

Explosion in tap changer at Northampton 132kV substation.

**UPDATE:** 

16/06/99: Tap changers of the coarse / fine winding type or reversing regulation

arrangements type on 132kV transformers. (with or without "tie in" resistors).

Taps to be locked to avoid tapping into the coarse / fine selector range (tap position 9–11). Failure can occur when the tapping mechanism reverses direction when in this range.

## **REMEDIAL ACTION:**