



1 SCOPE

This document details the application of SOP 216 issued by the Electricity Association.

2 ISSUE RECORD

This is a controlled maintained document

All copies printed via the Intranet or photocopied will be deemed uncontrolled.

Issue Date	Issue No	Author	Amendment Details
October 2000	1	Esther Stewart	Initial Issue in New Format: 2 Page Document

3 ISSUE AUTHORITY

Author	Owner	Issue Authority
Esther Stewart	Roger Bracey	Roger Bracey Group Head, Standards



4 SOP DETAILS

TYPE: Kelman "REZAP" low voltage cable fault auto recloser.

ORIGINATING REC: Northern Electric

DATE: 25/09/98

NO. INSTALLED IN MANWEB: N/A

NO. INSTALLED IN SCOTLAND:

STATUS: Ban

All Kelman "REZAP" low voltage cable fault auto reclosers shall be withdrawn from service until the original heavy current leads have been replaced.

REASON:

When a Kelman "REZAP" low voltage cable fault auto recloser was disconnected following an LV fault investigation, the LITTON connector became detached from the short length of heavy current leads connected to the in-line fuse. Examination of a similar unit showed that the connector could easily become detached.

Subsequent investigations by Kelman have shown that in some units the leads have been incorrectly terminated and that ALL units supplied to ScottishPower may have been fitted with suspect leads.

UPDATE:

REMEDIAL ACTION:

Original heavy current leads to be replaced.