

# 1 SCOPE

This document details the application of SOP 289 issued by the Electricity Association.

# 2 ISSUE RECORD

### This is a controlled maintained document

All copies printed via the Intranet or photocopied will be deemed uncontrolled.

Issue Date	Issue No	Author	Amendment Details
August 2002	1	David Naylor	Initial Issue 2 Page Document

# **3 ISSUE AUTHORITY**

Author	Owner	Issue Authority
David Naylor	Alastair Ferguson	Eric Leavy
Senior Project Engineer	Section Head	Engineering & Transmission
	Engineering Support	Operations Manager



# 4 SOP DETAILS

TYPE :	ABB Nitran LV Pillar

**ORIGINATING REC :** Defence Estates (DEO)

**DATE :** 11/01/2002

**NO. INSTALLED IN MANWEB:** None with voltage test sockets **NO. INSTALLED IN SCOTLAND:** Numerous

#### **STATUS :** Restriction:.

1. The insulated voltage test sockets fed from the top contacts (incoming side) of the transformer disconnector shall NOT be used for live testing under any circumstances.

2. Where it is required to check phasing across the transformer disconnector then this shall only be carried out using approved Drummond test lamps fitted with approved 83mm long insulated test probes. Access to the top contact of the disconnector shall only be gained using the 6mm diameter hole on the angled portion of the transformer disconnector shrouding.

3. Where it is required to measure voltage on the top side of the disconnector then this shall only be done using an approved voltmeter fitted with approved fused leads and test probes. Access to the top contact of the disconnector shall only be gained using the 6mm diameter hole on the angled portion of the transformer disconnector shrouding.

4. If a phase rotation check is required then this must be carried out by removing the fuses from all LV ways, closing the transformer disconnector and then connecting an approved phase rotation meter to the busbar connections on one of the outgoing ways of the LV fuse cabinet.

**REASON:** These LV pillars were available with optional voltage test sockets for testing voltage, phase rotation or phasing out. The insulating material around the sockets has been found to become brittle and break resulting in flashover.

#### **UPDATE:**

#### **REMEDIAL ACTION:**

Refer to DOM 2.2.3 Operational Restriction 54.